

OL-V801 Installation Guide

	10	Point	Touch	Overlay	/ for	the	V80
--	----	--------------	-------	---------	-------	-----	-----

Rev 1.1

1.0 Contents

Guide Purpose	Page 1
Notes and Warnings	Page 1
Equipment	Page 2
Dimensional Drawings	Page 2
Integration Procedures	Page 3



2.0 Purpose

2.1 This procedure describes the steps to install the OL-V801 IR Touch Overlay onto the V801 display

3.0 Notes and Warnings

- 3.1 The overlay contains tempered glass. Use caution when handling.
- 3.2 The overlay has an integrated USB cable located in the bottom right corner. Ensure the cable is not pinched, crushed, or damaged during installation.
- 3.3 Installation requires two persons at all times to ensure the touch screen frame does not bend or torque.
- 3.4 Once the touch screen is installed, do not lift the monitor by grasping or holding the touch screen overlay.
- 3.5 Contact NEC Display Solutions support if you have any questions or require additional installation guidance support.

500 Park Boulevard, Suite 1100 Itasca, IL 60143

Phone: (800) 632-4662

www.necdisplay.com OL-V801 1



OL-V801 Installation Guide


10 Point Touch Overlay for the V801

Rev 1.1

4.0 Equipment

- 4.1 (1) OL-V801 IR touch screen overlay
 - (8) M3 x 25 Flathead Phillips Machine Screws
 Note: Quantity (1) Machine Screw Provided as Spare
 - (1) 10ft. USB Extension Cable

5.0 Dimensional Drawings

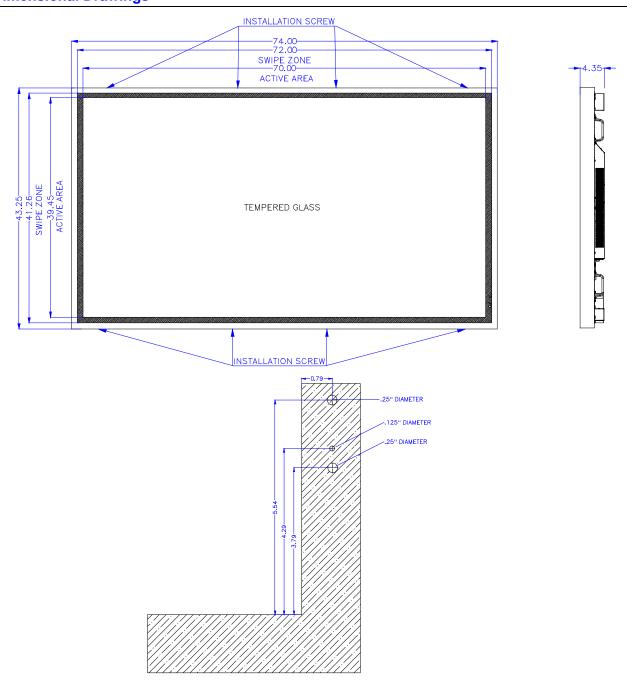

www.necdisplay.com OL-V801 2



OL-V801 Installation Guide

10 Point Touch Overlay for the V801


Rev 1.1

6.0 Integration Procedure

- 6.1 Place the display face up on a padded surface for overlay integration
 - 6.1.1 Note that if the unit is already mounted, removing the unit and placing it face up is optional; integration of the touch screen can also be done while the display is mounted
- 6.2 Remove bottom right corner screw from the factory bezel as shown.
- 6.3 Remove additional three (3) bottom screws; one located on the bottom far left corner and two located in the bottom centermost location of the factory bezel.
- 6.4 Remove four (4) screws located in the top of the factory bezel similar to the bottom screw removal in steps 6.2 and 6.3
 - 6.4.1 Note that only these eight (8) screws should be removed. The other screws are used to keep the bezel secured to the body of the display



- 6.5 Remove the IR touch screen overlay from packing and verify contents of kit parts.
- 6.6 Clean inside surface of the glass.
 - 6.6.1 Use a glass cleaner or mild cleaning solution to clean glass.
 - 6.6.2 Spray solution onto clean soft cloth then wipe the surface. Spraying cleaning solution directly onto the monitor may damage the unit.
 - 6.6.3 Use circular motion to avoid smudges and streaks.
 - 6.6.4 DO NOT USE any chemical solvents such as an Acidic, or Alkali solution.
- 6.7 With help from a partner, lift the touch frame on the side edges and place over the monitor.
- 6.8 Ensure the eight (8) mounting holes on the touch screen overlay align with the screw holes of the monitor.
- 6.9 Install the touch screen overlay using eight (8) M3 x 25 flathead Phillips machine screws.
- 6.10 Connect the touch screen USB cable to the PC / media player providing video to the display.
- 6.11 Installation is complete.

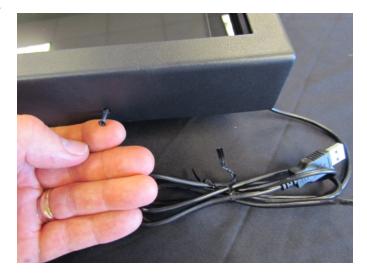

www.necdisplay.com OL-V801 3